

Copyright Hewlett-Packard Company 1977
P.O. Box 301, Loveland, Colorado 80537 U.S.A.

Microfiche Part No. 03466-90050

Manual Part No. 03466-90000

To help minimize the possibility of electrical fire or shock hazards, do not expose this instrument to rain or excess moisture.

WARNING

Any changes made in instruments manufactured after this printing will be found in a "Manual Changes" supplement supplied with this manual. Be sure to examine this supplement, if one exists for this manual, for any changes which apply to your instrument and record these changes in the manual.

IMPORTANT NOTICE

Serial Numbers 1716A00101 and Greater

**OPERATING AND SERVICE MANUAL
3466A
DIGITAL MULTIMETER**



For any assistance, contact your nearest Hewlett-Packard Sales and Service Office. Addresses are provided at the back of this manual.

Service contracts or customer assistance agreements are available for Hewlett-Packard products.

If this product is sold as part of a Hewlett-Packard integrated instrument system, the above warranty shall not be applicable, and this product shall be covered only by the system warranty.

This Hewlett-Packard product is warranted against defects in materials and workmanship for a period of one year from the date of shipment, except that in the case of certain components, if any, listed in Section I of this operating manual, the warranty shall be for the specified period. Hewlett-Packard will, at its option, repair or replace products which prove to be defective during the warranty period provided they are returned to Hewlett-Packard, and provided the proper preventive maintenance procedures as listed in this manual are followed. Repairs necessitated by misuse of the product are not covered by this warranty. NO OTHER WARRANTIES ARE EXPRESSED OR IMPLIED, INCLUDING BUT NOT LIMITED TO THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE. HEWLETT-PACKARD IS NOT LIABLE FOR CONSEQUENTIAL DAMAGES.

WARRANTY AND ASSISTANCE

Hewlett-Packard Company certifies that this instrument met its published specifications at the time of shipment from the factory. Hewlett-Packard Company further certifies that its calibration measurements are traceable to the United States National Bureau of Standards, to the extent allowed by the Bureau's calibration facility, and to the calibration facilities of other International Standards Organization members.

CERTIFICATION

HEWLETT  PACKARD

MANUAL CHANGES

MODEL 3466A

DIGITAL MULTIMETER

Manual Part No. 03466-90000

ERRATA

■ New or Revised Item

Page 3-1, Figure 3-3. Change the "OL" indication as shown in Figure CS1.

 


Figure CS1. Replaces Figure 3-3.

Page 3-2, Paragraph 3-14. Change the second to last sentence to read: "Figure 3-4 shows the autoranging points of ac voltage measurements from 0 to 1200 V ac."

Page 3-2, Figure 3-2. Change 1700.0 V (Max) to 1200.0 V (Max) and delete the ["*"] above that input level.

Page 3-6, Figure 3-15, under Ω (OHMS). Change 100 μ A to 100 nA under I for the 20 M Ω range.

Page 4-3, Figure 4-3. Delete the ground symbol (\perp) from the 740B plus (+) terminal.

Page 4-7, Paragraph 4-26. Change Paragraph 4-26 to read: "... AC Voltage measurements with interfering signals at power line frequencies. . . ."

Page 4-7, Figure 4-9. Change the Multimeter connections as shown in Figure CS2.

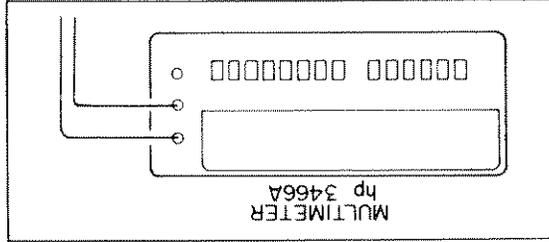


Figure CS2. P/O Figure 4-9.

Page 6-6, Table 6-3, under A1 Miscellaneous Parts. Add hp- Part Number 1251-3379, Gold Standoff Pins for U102.

Page 8-1, Paragraph 8-6. Change *for to from* in the second sentence.

- Page 8-2, Paragraph 8-14. Change *in to fs* in the second sentence.
- Page 8-3, Paragraph 8-25. Change *same to some* in the first sentence.
- Page 8-8, Figure 8-10. Change the Overall Gain of the 20 V Range from X1 to X0.1.
- Page 8-10, Figure 8-13. Change the R_X of the 2M (Ω) Range from 100 K to 1 M. Change the R_X of the 200 (Ω) Range from 1 K to 100.
- Page 8-11, Paragraph 8-71. Change the first sentence to read: When the clock is turned back on, the information in the counters is transferred to the display.
- CHANGE NO. 1 applies to all serial numbers.
- Page 1-2 and 1-3. Replace pages 1-2 and 1-3 with the attached revised pages.
- Page 4-2, Table 4-3. Change the Test Frequency and Multimeter Display Limits as shown in Table CS-1.

Table CS-1. AC Voltmeter Accuracy Test.

Range	AC Calibrator Output	Test Frequency	Multimeter Display Limits	
200 mV	20 mV	20 Hz	19.10 to 20.90 mV	
	20 mV	50 Hz	19.74 to 20.26 mV	
	20 mV	20 kHz	19.40 to 20.60 mV	
	50 mV	50 Hz	47.50 to 52.50 mV	
	50 mV	100 kHz	49.20 to 50.80 mV	
	50 mV	30 Hz	49.65 to 50.35 mV	
	100 mV	20 Hz	97.50 to 102.50 mV	
	100 mV	50 Hz	99.50 to 100.50 mV	
	100 mV	20 kHz	98.60 to 101.40 mV	
	100 mV	30 Hz	187.80 to 192.20 mV	
	2 V	.2 V	30 Hz	1.950 to 2.050 V
		1.9 V	100 kHz	1.8470 to 1.9530 V
1 V		10 kHz	.9950 to 1.0050 V	
20 V		2 V	20 Hz	1.910 to 2.090 V
		2 V	30 Hz	1.950 to 2.050 V
		2 V	50 Hz	1.974 to 2.026 V
		2 V	200 Hz	1.974 to 2.026 V
		2 V	10 kHz	1.974 to 2.026 V
		5 V	10 kHz	4.965 to 5.035 V
		5 V	20 kHz	4.950 to 5.450 V
		5 V	100 kHz	18.923 to 19.077 V
		19 V	10 kHz	18.923 to 19.077 V
	19 V	20 kHz	18.470 to 19.530 V	
	200 V	20 V	20 kHz	19.40 to 20.60 V
		100 V	50 Hz	99.50 to 100.50 V
190 V		20 Hz	185.70 to 194.50 V	
1200 V		200 V	20 kHz	197.4 to 202.6 V
		500 V	30 Hz	492.0 to 508.0 V
		1000 V	10 kHz	995.0 to 1005.0 V

Page 4-3, Table 4-4. Change the AC Calibrator Frequency and Display Limits as shown in Table CS-2.

(10A) (10B) TRUE RMS Converter Adjustment (R308 and R309).

NOTE

Center R308 and R309 before performing this procedure.

a. Set the Multimeter to the DCV + ACV Function, 20 V Range.

b. Set the DC Standard for a +1,9000 V dc output and connect it to the Multimeter input terminals.

c. Note the Multimeter display reading.

d. Reverse the polarity of the dc voltage at the Multimeter input terminals (positive to negative).

e. Adjust R308 (10A) for the same display reading as noted in Step c (opposite polarity).

f. Change the DC Standard output to + 19,000 V dc and change the input at the Multimeter back to positive.

g. Note the Multimeter display reading.

h. Reverse the polarity of the input voltage (positive to negative).

i. Adjust R309 (10B) for the same reading as noted in Step g ± 5 counts (opposite polarity).

j. Repeat Step a through i until both adjustments (10A and 10B) are correct.

k. Repeat Adjustments (9) and (10) before proceeding to adjustment (11).

Page 5-5, Figure 5-2. Add adjustments (10A) and (10B) as shown in Figure CS-3.

Figure CS-3. P/O Figure 5-2.

Page 6-3 through 6-9, Table 6-3. Change the Replaceable Parts List as shown in Table CS-6.

The A4 PC Assembly must be removed and Service Cable (03466-61601) installed before performing these adjustments.

The following adjustments (R308 and R309) need only be performed if the A5 PC assembly is installed in place of U300.

NOTE

Page 5-4, After Paragraph 5-26. Add the following paragraphs:

4-10 AC Voltmeter Accuracy

4-11 TRMS Voltmeter Accuracy

Range	DC Standard	AC Calibrator Output	Frequency	Display Limit (TRMS)
200 mV	20 mV	20 mV	20 Hz	27.20 to 29.37
50 mV	50 mV	50 mV	50 Hz	69.20 to 72.21
100 mV	100 mV	100 mV	20 kHz	139.20 to 143.63
200 mV	200 mV	200 mV	100 kHz	257.2 to 308.5
500 mV	500 mV	30 Hz	30 Hz	69.20 to 72.21
1 V	1 V	10 kHz	10 kHz	1,392.0 to 1,436.3
2 V	2 V	20 Hz	20 Hz	2,720.2, 937
5 V	5 V	50 Hz	50 Hz	6,920 to 7,221
10 V	10 V	10 V	20 kHz	13,920 to 14,363
20 V	20 V	20 V	100 kHz	25,72 to 30,85
50 V	50 V	50 V	30 Hz	69,20 to 72,21
100 V	100 V	100 V	10 kHz	139,20 to 143,63

Table CS-2. True RMS Voltmeter Accuracy Test.

Table CS-4. P/O Abbreviated Performance Test Card.

4-10	200 mV Range/20 mV, 20 Hz	19,10 to 20,90 mV
	2 V Range/1.9 V, 100 kHz	1,8470 to 1,9530
	20 V Range/2 V, 200 Hz	1,874 to 2,026 V
	20 V Range/2 V, 10 kHz	1,974 to 2,026 V
	20 V Range/19 V, 200 Hz	18,923 to 19,077 V
	20 V Range/19 V, 10 kHz	18,923 to 19,077 V
	20 V Range/19 V, 100 kHz	18,470 to 19,530 V
	200 V Range/190 V, 20 Hz	185,70 to 194,30 V
	1200 V Range/200 V, 10 kHz	197,4 to 202,6 V
4-11	200 mV Range/14.14 mV, 20 kHz	139,20 to 143,63
	20 V Range/1.414 V, 20 kHz	139,20 to 14,363
	200 V Range/28,28 V, 100 kHz	25,72 to 30,85

Page 5-4, After Paragraph 5-26. Add the following paragraphs:

NOTE

The following adjustments (R308 and R309) need only be performed if the A5 PC assembly is installed in place of U300.

The A4 PC Assembly must be removed and Service Cable (03466-61601) installed before performing these adjustments.

Range	Value	DC Standard Output	AC Calibrator Output	Frequency	Multimeter Display Limit (TRMS)
200 µA	100 kΩ ± 0.1%	2 V	2 V	100 Hz	26,78 to 29,22 µA
2 mA	100 kΩ ± 0.1%	20 V	20 V	100 Hz	2,703 to 2,948 mA
20 mA	10 kΩ ± 0.1%	20 V	20 V	100 Hz	2,703 to 2,947 mA

Table CS-3. True RMS Ammeter Accuracy Test.

Paragraph Number	Test	Test Limit	Test Results
4-10	AC Voltmeter Accuracy 200 mV Range 20 mV 20 Hz 20 mV 50 Hz 20 mV 100 KHz 20 mV 20 KHz 50 mV 10 KHz 100 mV 20 Hz 100 mV 50 Hz 100 mV 20 KHz 2 V Range 2 V 30 Hz 1.9 V 100 KHz 1 V 10 KHz 2 V Range 2 V 30 Hz 1.9 V 30 Hz 100 mV 20 KHz 100 mV 50 Hz 100 mV 100 KHz 50 mV 20 KHz 50 mV 30 Hz 200 mV Range 20 mV 20 Hz 2 V 20 Hz 2 V 50 Hz 2 V 100 KHz 2 V 200 Hz 2 V 10 KHz 5 V 10 KHz 5 V 20 KHz 19 V 10 KHz 19 V 100 KHz 200 V Range 20 V 20 KHz 100 V 50 Hz 190 V 20 Hz 1200 V Range 190 V 10 KHz 500 V 30 Hz 1000 V 10 KHz	19.10 to 20.90 mV 19.74 to 20.26 mV 19.40 to 20.60 mV 47.50 to 52.50 mV 49.20 to 50.80 mV 49.65 to 50.53 mV 97.50 to 102.50 mV 99.50 to 100.50 mV 98.60 to 101.40 mV 187.80 to 192.20 1.950 to 2.050 1.8470 to 1.9530 V .9950 to 1.0050 V 1.910 to 2.090 V 1.950 to 2.050 V 1.974 to 2.026 V 1.974 to 2.026 V 1.974 to 2.026 V 1.974 to 2.026 V 4.965 to 5.035 V 4.550 to 5.450 V 18.923 to 19.077 V 18.470 to 19.530 V 19.40 to 20.60 V 99.50 to 100.50 V 185.70 to 184.30 V 187.4 to 192.6 V 492.0 to 508.0 V 995.0 to 1005.0 V	Test Results
4-12	True RMS Voltmeter Accuracy (DCV + ACV) DCV ACV (RMS) TRMS 200 mV Range 20 mV 20 Hz 28.28 mV 50 mV 50 Hz 70.70 mV 100 mV 100 mV, 20 KHz 141.41 mV 2 V Range 2 V 20 Hz 2.828 5 V 50 Hz 7.070 V 10 V 20 KHz 14.141 V 200 V Range 20 V 100 KHz 28.28 50 V 30 Hz 70.70 V 100 V 10 KHz 141.41 V	27.20 to 29.37 mV 69.20 to 72.21 mV 139.20 to 143.63 mV 25.72 to 30.85 V 69.20 to 72.21 V 13.920 to 14.363 V 2.720 to 2.937 V 69.20 to 7.221 V 1.3920 to 1.4363 V 25.72 to 30.85 V 69.20 to 72.21 V 1.3920 to 1.4363 V 27.20 to 29.37 mV 69.20 to 72.21 mV 139.20 to 143.63 mV	Test Results

Table CS-5, P/O Performance Test Card.

Figure CS-4, P/O Figure 8-19.


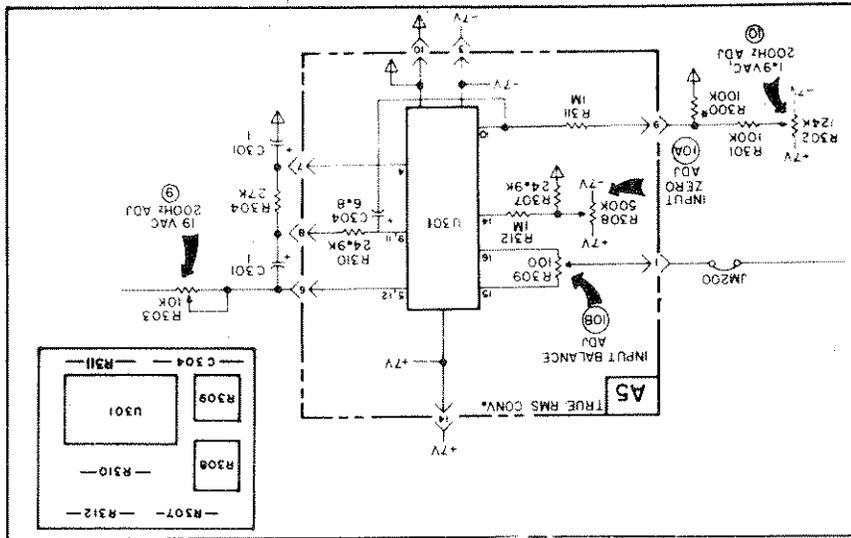


Figure CS-5, Add A4C907 and L901.

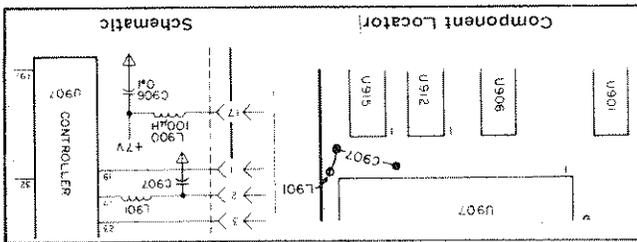

In some instruments, U300 is replaced with a plug-in PC assembly (A5) which performs the same basic function as U300.

Page 8-21, Figure 8-19. In some instruments the True RMS Converter (U300 and associated components) will be replaced by the schematic shown in Figure CS-4. This figure includes the A5 PC assembly and its component locator.

Page 8-23, Figure 8-20. Add C907 and L901 to the A4 Logic Board Schematic and Component Locator as shown in Figure CS-5.

NOTE

Page 8-7. Add the following note after Paragraph 8-54.

Reference Designator	Part No.	Description
A1C300*	0180-0100	CAP-FXD 4.7 μ F \pm 10%
A1C303*	0160-2940	CAP-FXD 470 pF \pm 5%
A1R300*	0757-0401	RES 100 Ω \pm 1% .125W F TC=0 \pm 100 (Used When Installed)
A1U300*	1826-0421	RES 100 K Ω \pm 1% (Used When A5 is Installed)
A1X300	1200-0424	Socket-IC 14 Pin When A5 is Installed
A5*	03466-66505	True RMS Converter NOTE: A5 replaces U300
A5C304*	0180-1701	Cap-Fxd 6.8 μ F 6 VDC TA
A5R307*	0698-4486	RES 24.9 K Ω 1% .125W
A5R308*	2100-0580	RES-Trimr 500 K Ω pot
A5R309*	2100-0568	RES-Trimr 100 K Ω pot
A5R310*	0698-4486	RES 24.9 K Ω 1% .125W
A5R311*	0698-7332	RES 1 M Ω .125W
R312*		IC Linear
A5U301	1826-0499	IC Socket
A5XU301	1251-5138	1 μ F
A4C907	0180-0291	15 μ H
A4L901	9100-3912	

Table CS-6, P/O Table 6-3.

Paragraph Number	Test	Test Limit	Test Results
4-18	True RMS Ammeter Accuracy (DCI + ACI)		
	DCI ACI (RMS) TRMS		
	200 μ A	26.78 to 29.22 μ A	
	2 mA Range	.2703 to .2948	
	20 mA Range	2.703 to 2.947	
	1.998 mA, 100 Hz		
	19.8 μ A, 100 Hz		
	1.998 mA, 100 Hz		
	20 mA Range		
	1.998 mA, 100 Hz		
	2 mA Range		
	1.998 mA, 100 Hz		
	20 mA Range		
	1.998 mA, 100 Hz		

Table CS-5, P/O Performance Test Card (Cont'd).

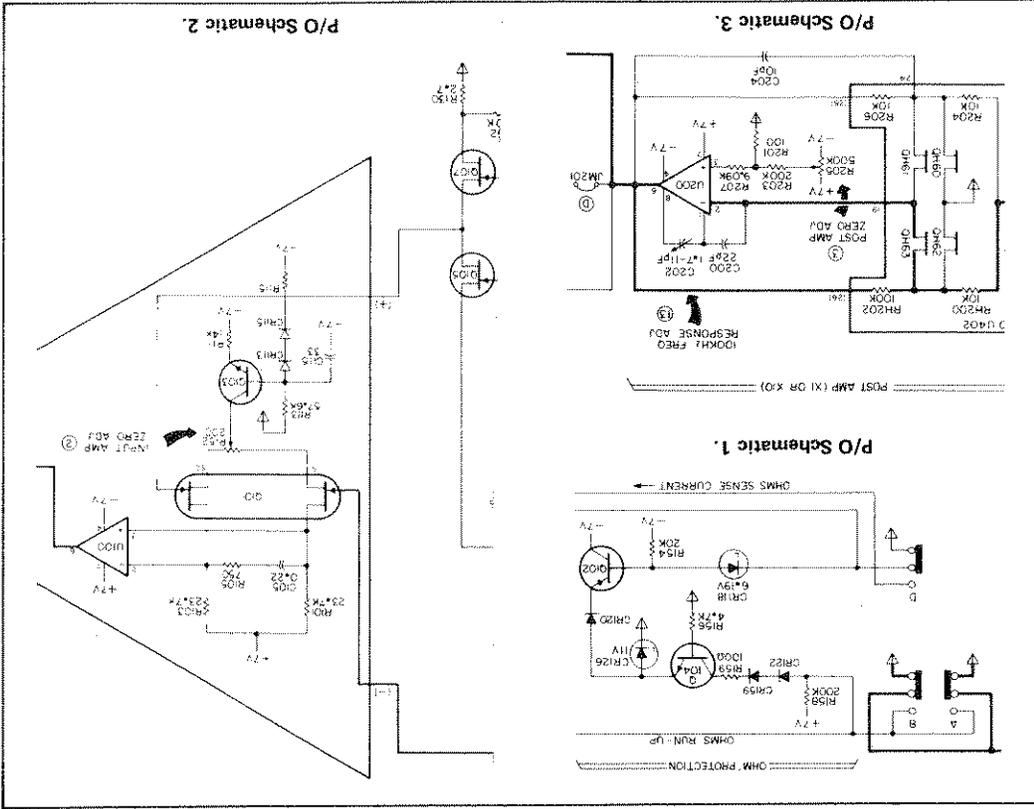


Figure CS-7.

Page 8-19 and 8-21. Change Schematic 1, 2, and 3 as shown in Figure CS-7.

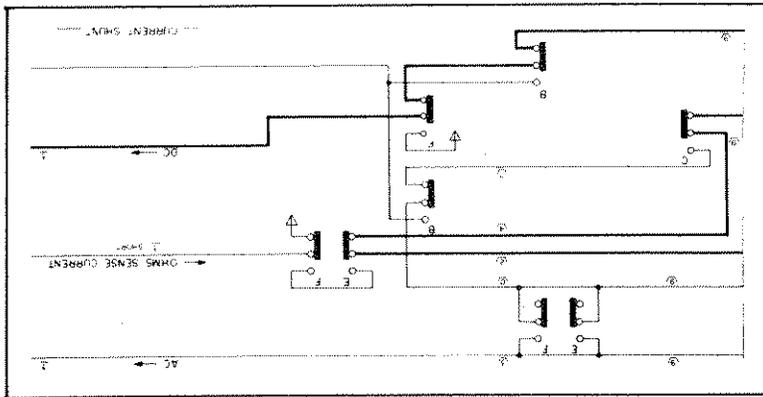


Figure CS-6. P/O A1SS.

Page 8-17, Figure 8-17. Add section F to SS as shown in Figure CS-6.

CHANGE NO. 2 applies to serial numbers 1716A00251 and greater.

Page 6-10, Table 6-3 and 6-4. Change the part number of the PC shield (Top) from 03466-00601 to 03466-00603.

CHANGE NO. 3 applies to serial numbers 1716A00526 and greater.

Page 6-3, 6-4, 6-5; Table 6-3. Change and/or add following components as shown in Table CS-7.

Table CS-7. P/O Table 6-3.

Change:	To:
A1C111	A1C111*
A1C115	0180-0229, 33 μ F 10 V
A1R111	0698-4479, 14 K \pm 1/8 W
A1R113	0698-4500, 57.6 K \pm 1%
A1R115	0698-4504, 69.8 K \pm 1%
A2P1	1251-4112, Connector 25 pin Male
Add:	
A1CR113, 115	1901-0040, DIO-S1 .05 A 30 V
A1R207	0757-0288, 9.09 K \pm 1%
A1R159	0698-8768, 100 Ω
A1Q105, 107	1855-0270, JFET
Delete:	
A1Q106	

DC VOLT METER.		AC VOLT METER (TRUE RMS).																											
<p>Accuracy: (for 1 year at 23°C ± 5°C):</p> <table border="1"> <tr> <th>Range</th> <th>Max. Display</th> </tr> <tr> <td>± 20 mV</td> <td>19,999 mV</td> </tr> <tr> <td>± 200 mV</td> <td>1,999.9 mV</td> </tr> <tr> <td>± 2 V</td> <td>1,999.9 V</td> </tr> <tr> <td>± 20 V</td> <td>19,999 V</td> </tr> <tr> <td>± 200 V</td> <td>199,99 V</td> </tr> <tr> <td>± 1200 V</td> <td>1199.9 V</td> </tr> </table>		Range	Max. Display	± 20 mV	19,999 mV	± 200 mV	1,999.9 mV	± 2 V	1,999.9 V	± 20 V	19,999 V	± 200 V	199,99 V	± 1200 V	1199.9 V	<p>Accuracy: (for 1 year at 23°C ± 5°C and at > 1900 digits):</p> <table border="1"> <tr> <th>Range</th> <th>Max. Display</th> </tr> <tr> <td>200 mV</td> <td>199.99 mV</td> </tr> <tr> <td>2 V</td> <td>1,999.9 V</td> </tr> <tr> <td>20 V</td> <td>19,999 V</td> </tr> <tr> <td>200 V</td> <td>199,99 V</td> </tr> <tr> <td>1200 V</td> <td>1199.9 V</td> </tr> </table>		Range	Max. Display	200 mV	199.99 mV	2 V	1,999.9 V	20 V	19,999 V	200 V	199,99 V	1200 V	1199.9 V
Range	Max. Display																												
± 20 mV	19,999 mV																												
± 200 mV	1,999.9 mV																												
± 2 V	1,999.9 V																												
± 20 V	19,999 V																												
± 200 V	199,99 V																												
± 1200 V	1199.9 V																												
Range	Max. Display																												
200 mV	199.99 mV																												
2 V	1,999.9 V																												
20 V	19,999 V																												
200 V	199,99 V																												
1200 V	1199.9 V																												
<p>Response Time: < 4.5 seconds to within 4 digits of final value on one range. Add 1.2 seconds for each range change.</p> <p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <th>Frequency</th> <th>Temperature Coefficient (all ranges)</th> </tr> <tr> <td>20 Hz to 30 Hz and 50 KHz to 100 KHz</td> <td>± (.05% of reading + 5 digits)/°C</td> </tr> <tr> <td>30 Hz to 50 Hz and 20 KHz to 50 KHz</td> <td>± (.05% of reading + 2 digits)/°C</td> </tr> <tr> <td>50 Hz to 20 KHz</td> <td>± (.03% of reading + 5 digits)/°C</td> </tr> </table> <p>Maximum Crest Factor: 4 to 1</p>		Frequency	Temperature Coefficient (all ranges)	20 Hz to 30 Hz and 50 KHz to 100 KHz	± (.05% of reading + 5 digits)/°C	30 Hz to 50 Hz and 20 KHz to 50 KHz	± (.05% of reading + 2 digits)/°C	50 Hz to 20 KHz	± (.03% of reading + 5 digits)/°C	<p>Response Time: < 0.7 seconds to within 1 digit of final value on one range. Add 0.8 seconds for each range change.</p> <p>Temperature Coefficient: ± (.003% of reading + 0.15 Digits)/°C (0°C to 18°C and 28°C to 55°C).</p> <p>Normal-Mode Rejection: ≥ 60 dB at 50/60 Hz ± 0.1%.</p> <p>Effective Common-Mode Rejection: ≥ 140 dB at dc; 120 dB at 50/60 Hz ± 1% (1 KΩ imbalance).</p>																			
Frequency	Temperature Coefficient (all ranges)																												
20 Hz to 30 Hz and 50 KHz to 100 KHz	± (.05% of reading + 5 digits)/°C																												
30 Hz to 50 Hz and 20 KHz to 50 KHz	± (.05% of reading + 2 digits)/°C																												
50 Hz to 20 KHz	± (.03% of reading + 5 digits)/°C																												
<p>Input Impedance: Resistance: 2 MΩ ± 0.5%.</p> <p>Shunt Capacitance: < 50 pF.</p> <p>Sensitivity: 10 μV on the 200 mV range.</p>		<p>Input Resistance: 10 MΩ ± 0.5% (all ranges).</p> <p>Sensitivity: 1 μV on the 20 mV range.</p>																											
<p>DC + AC VOLT METER (TRUE RMS).</p>		<p>AC VOLT METER (TRUE RMS).</p>																											
<p>Input Type: Floating (500 V max. from COM to earth ground).</p> <p>Ranging: Automatic or Manual.</p> <p>Maximum Input: ± 1200 V (dc + peak ac).</p>		<p>Input Type: Floating (500 V max. from COM to earth ground).</p> <p>Ranging: Automatic or Manual.</p> <p>Maximum Input: 600 Vdc or 1700 V (dc + peak ac), 10⁷ V Hz.</p>																											
<p>Input Impedance: Resistance: 2 MΩ ± 0.5%.</p> <p>Shunt Capacitance: < 50 pF.</p> <p>Sensitivity: 10 μV on the 200 mV range.</p>		<p>Input Impedance: Resistance: 2 MΩ ± 0.5%.</p> <p>Shunt Capacitance: < 50 pF.</p> <p>Sensitivity: 10 μV on the 200 mV range.</p>																											
<p>DC + AC VOLT METER (TRUE RMS).</p>		<p>AC VOLT METER (TRUE RMS).</p>																											
<p>Input Type: Floating (500 V max. from COM to earth ground).</p> <p>Ranging: Automatic or Manual.</p> <p>Maximum Input: 600 Vdc or 1700 V (dc + peak ac), 10⁷ V Hz.</p>		<p>Input Type: Floating (500 V max. from COM to earth ground).</p> <p>Ranging: Automatic or Manual.</p> <p>Maximum Input: 600 Vdc or 1700 V (dc + peak ac), 10⁷ V Hz.</p>																											
<p>Input Impedance: Resistance: 2 MΩ ± 0.5%.</p> <p>Shunt Capacitance: < 50 pF.</p> <p>Sensitivity: 10 μV on the 200 mV range.</p>		<p>Input Impedance: Resistance: 2 MΩ ± 0.5%.</p> <p>Shunt Capacitance: < 50 pF.</p> <p>Sensitivity: 10 μV on the 200 mV range.</p>																											

Table 1-1. Specifications.

DC AMMETER		AC AMMETER (TRUE RMS)																											
<p>Accuracy: (for 1 year at 23°C ± 5°C)</p> <table border="1"> <tr> <td>200 µA</td> <td>± (.07% of reading + 2 digits)</td> </tr> <tr> <td>2 mA</td> <td>± (.07% of reading + 2 digits)</td> </tr> <tr> <td>19.999 mA</td> <td>± (.07% of reading + 2 digits)</td> </tr> <tr> <td>10 Ω</td> <td>± (.07% of reading + 2 digits)</td> </tr> <tr> <td>199.99 mA</td> <td>± (.15% of reading + 2 digits)</td> </tr> <tr> <td>1 Ω</td> <td>± (.15% of reading + 2 digits)</td> </tr> <tr> <td>1999.9 mA</td> <td>± (.5% of reading + 2 digits)</td> </tr> <tr> <td>0.1 Ω</td> <td>± (.5% of reading + 2 digits)</td> </tr> </table>		200 µA	± (.07% of reading + 2 digits)	2 mA	± (.07% of reading + 2 digits)	19.999 mA	± (.07% of reading + 2 digits)	10 Ω	± (.07% of reading + 2 digits)	199.99 mA	± (.15% of reading + 2 digits)	1 Ω	± (.15% of reading + 2 digits)	1999.9 mA	± (.5% of reading + 2 digits)	0.1 Ω	± (.5% of reading + 2 digits)	<p>Accuracy: (for 1 year at 23°C ± 5°C)</p> <table border="1"> <tr> <td>200 µA thru 20 mA</td> <td>± (.01% of reading + .15 digits)/°C</td> </tr> <tr> <td>2 mA</td> <td>± (.01% of reading + .15 digits)/°C</td> </tr> <tr> <td>19.999 mA</td> <td>± (.01% of reading + .15 digits)/°C</td> </tr> <tr> <td>200 mA</td> <td>± (.01% of reading + .15 digits)/°C</td> </tr> <tr> <td>2000 mA</td> <td>± (.01% of reading + .15 digits)/°C</td> </tr> </table>		200 µA thru 20 mA	± (.01% of reading + .15 digits)/°C	2 mA	± (.01% of reading + .15 digits)/°C	19.999 mA	± (.01% of reading + .15 digits)/°C	200 mA	± (.01% of reading + .15 digits)/°C	2000 mA	± (.01% of reading + .15 digits)/°C
200 µA	± (.07% of reading + 2 digits)																												
2 mA	± (.07% of reading + 2 digits)																												
19.999 mA	± (.07% of reading + 2 digits)																												
10 Ω	± (.07% of reading + 2 digits)																												
199.99 mA	± (.15% of reading + 2 digits)																												
1 Ω	± (.15% of reading + 2 digits)																												
1999.9 mA	± (.5% of reading + 2 digits)																												
0.1 Ω	± (.5% of reading + 2 digits)																												
200 µA thru 20 mA	± (.01% of reading + .15 digits)/°C																												
2 mA	± (.01% of reading + .15 digits)/°C																												
19.999 mA	± (.01% of reading + .15 digits)/°C																												
200 mA	± (.01% of reading + .15 digits)/°C																												
2000 mA	± (.01% of reading + .15 digits)/°C																												
<p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 µA thru 20 mA</td> <td>± (.03% of reading + .5 digits)/°C</td> </tr> <tr> <td>2000 mA</td> <td>± (.04% of reading + .5 digits)/°C</td> </tr> </table>		200 µA thru 20 mA	± (.03% of reading + .5 digits)/°C	2000 mA	± (.04% of reading + .5 digits)/°C	<p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 µA thru 20 mA</td> <td>± (.03% of reading + 10 digits)/°C</td> </tr> <tr> <td>200 mA</td> <td>± (.03% of reading + 10 digits)/°C</td> </tr> <tr> <td>2000 mA</td> <td>± (.03% of reading + 10 digits)/°C</td> </tr> </table>		200 µA thru 20 mA	± (.03% of reading + 10 digits)/°C	200 mA	± (.03% of reading + 10 digits)/°C	2000 mA	± (.03% of reading + 10 digits)/°C																
200 µA thru 20 mA	± (.03% of reading + .5 digits)/°C																												
2000 mA	± (.04% of reading + .5 digits)/°C																												
200 µA thru 20 mA	± (.03% of reading + 10 digits)/°C																												
200 mA	± (.03% of reading + 10 digits)/°C																												
2000 mA	± (.03% of reading + 10 digits)/°C																												
<p>Sensitivity: 10 nA on the 200 µA range.</p>		<p>Sensitivity: 10 nA on the 200 µA range.</p>																											
<p>Maximum Input: ± 2 Amps from ≤250 V Source.</p>		<p>Maximum Input: 2 Amps rms from ≤250 V rms source.</p>																											
<p>Ranging: Manual only.</p>		<p>Ranging: Manual only.</p>																											
<p>Input Type: Floating (500 V max. from COM to earth ground).</p>		<p>Input Type: Floating (500 V max. from COM to earth ground).</p>																											
<p>Polarity: Automatically sensed and displayed.</p>																													
<p>Minimum Display: 1900 digits.</p>		<p>Minimum Display: 1900 digits.</p>																											
<p>Maximum Crest Factor: 4 to 1</p>		<p>Maximum Crest Factor: 4 to 1</p>																											
<p>Max. Burden at Full Scale</p> <table border="1"> <tr> <td>< 220 mV rms</td> <td>200 µA thru 20 mA</td> </tr> <tr> <td>< 240 mV rms</td> <td>200 mA</td> </tr> <tr> <td>< 600 mV rms</td> <td>2000 mA</td> </tr> </table>		< 220 mV rms	200 µA thru 20 mA	< 240 mV rms	200 mA	< 600 mV rms	2000 mA	<p>Max. Burden at Full Scale</p> <table border="1"> <tr> <td>< 200 mV</td> <td>200 µA thru 20 mA</td> </tr> <tr> <td>< 240 mV</td> <td>200 mA</td> </tr> <tr> <td>< 600 mV</td> <td>2000 mA</td> </tr> </table>		< 200 mV	200 µA thru 20 mA	< 240 mV	200 mA	< 600 mV	2000 mA														
< 220 mV rms	200 µA thru 20 mA																												
< 240 mV rms	200 mA																												
< 600 mV rms	2000 mA																												
< 200 mV	200 µA thru 20 mA																												
< 240 mV	200 mA																												
< 600 mV	2000 mA																												
<p>Shunt Resistance</p> <table border="1"> <tr> <td>1000 Ω</td> <td>199.99 µA</td> </tr> <tr> <td>100 Ω</td> <td>1.9999 mA</td> </tr> <tr> <td>10 Ω</td> <td>19.999 mA</td> </tr> <tr> <td>1 Ω</td> <td>199.99 mA</td> </tr> <tr> <td>0.1 Ω</td> <td>1999.9 mA</td> </tr> </table>		1000 Ω	199.99 µA	100 Ω	1.9999 mA	10 Ω	19.999 mA	1 Ω	199.99 mA	0.1 Ω	1999.9 mA	<p>Max. Display</p> <table border="1"> <tr> <td>199.99 µA</td> <td>200 µA</td> </tr> <tr> <td>1.9999 mA</td> <td>2 mA</td> </tr> <tr> <td>19.999 mA</td> <td>20 mA</td> </tr> <tr> <td>199.99 mA</td> <td>200 mA</td> </tr> <tr> <td>1999.9 mA</td> <td>2000 mA</td> </tr> </table>		199.99 µA	200 µA	1.9999 mA	2 mA	19.999 mA	20 mA	199.99 mA	200 mA	1999.9 mA	2000 mA						
1000 Ω	199.99 µA																												
100 Ω	1.9999 mA																												
10 Ω	19.999 mA																												
1 Ω	199.99 mA																												
0.1 Ω	1999.9 mA																												
199.99 µA	200 µA																												
1.9999 mA	2 mA																												
19.999 mA	20 mA																												
199.99 mA	200 mA																												
1999.9 mA	2000 mA																												
<p>Accuracy</p> <table border="1"> <tr> <td>± (.07% of reading + 2 digits)</td> <td>200 µA thru 20 mA</td> </tr> <tr> <td>± (.07% of reading + 2 digits)</td> <td>2 mA</td> </tr> <tr> <td>± (.07% of reading + 2 digits)</td> <td>19.999 mA</td> </tr> <tr> <td>± (.07% of reading + 2 digits)</td> <td>200 mA</td> </tr> <tr> <td>± (.15% of reading + 2 digits)</td> <td>2000 mA</td> </tr> </table>		± (.07% of reading + 2 digits)	200 µA thru 20 mA	± (.07% of reading + 2 digits)	2 mA	± (.07% of reading + 2 digits)	19.999 mA	± (.07% of reading + 2 digits)	200 mA	± (.15% of reading + 2 digits)	2000 mA	<p>Accuracy</p> <table border="1"> <tr> <td>± (.07% of reading + 50 digits)</td> <td>20 Hz to 30 Hz</td> </tr> <tr> <td>± (.9% of reading + 35 digits)</td> <td>30 Hz to 10 kHz</td> </tr> <tr> <td>± (2% of reading + 50 digits)</td> <td>20 Hz to 30 Hz</td> </tr> <tr> <td>± (1.2% of reading + 20 digits)</td> <td>30 Hz to 10 kHz</td> </tr> </table>		± (.07% of reading + 50 digits)	20 Hz to 30 Hz	± (.9% of reading + 35 digits)	30 Hz to 10 kHz	± (2% of reading + 50 digits)	20 Hz to 30 Hz	± (1.2% of reading + 20 digits)	30 Hz to 10 kHz								
± (.07% of reading + 2 digits)	200 µA thru 20 mA																												
± (.07% of reading + 2 digits)	2 mA																												
± (.07% of reading + 2 digits)	19.999 mA																												
± (.07% of reading + 2 digits)	200 mA																												
± (.15% of reading + 2 digits)	2000 mA																												
± (.07% of reading + 50 digits)	20 Hz to 30 Hz																												
± (.9% of reading + 35 digits)	30 Hz to 10 kHz																												
± (2% of reading + 50 digits)	20 Hz to 30 Hz																												
± (1.2% of reading + 20 digits)	30 Hz to 10 kHz																												
<p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 µA thru 200 mA</td> <td>± (.03% of reading + 10 digits)/°C</td> </tr> <tr> <td>200 mA</td> <td>± (.03% of reading + 10 digits)/°C</td> </tr> <tr> <td>2000 mA</td> <td>± (.03% of reading + 10 digits)/°C</td> </tr> </table>		200 µA thru 200 mA	± (.03% of reading + 10 digits)/°C	200 mA	± (.03% of reading + 10 digits)/°C	2000 mA	± (.03% of reading + 10 digits)/°C	<p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 µA thru 200 mA</td> <td>± (.03% of reading + 10 digits)/°C</td> </tr> <tr> <td>200 mA</td> <td>± (.03% of reading + 10 digits)/°C</td> </tr> <tr> <td>2000 mA</td> <td>± (.03% of reading + 10 digits)/°C</td> </tr> </table>		200 µA thru 200 mA	± (.03% of reading + 10 digits)/°C	200 mA	± (.03% of reading + 10 digits)/°C	2000 mA	± (.03% of reading + 10 digits)/°C														
200 µA thru 200 mA	± (.03% of reading + 10 digits)/°C																												
200 mA	± (.03% of reading + 10 digits)/°C																												
2000 mA	± (.03% of reading + 10 digits)/°C																												
200 µA thru 200 mA	± (.03% of reading + 10 digits)/°C																												
200 mA	± (.03% of reading + 10 digits)/°C																												
2000 mA	± (.03% of reading + 10 digits)/°C																												
<p>Response Time: < 4.5 seconds to within 4 digits of final value.</p>		<p>Response Time: < 4.5 seconds to within 4 digits of final value.</p>																											
<p>Input Protection: 2A, 250 V Fuse.</p>		<p>Input Protection: 2A, 250 V Fuse.</p>																											
<p>Max. Burden at Full Scale</p> <table border="1"> <tr> <td>< 220 mV rms</td> <td>200 µA thru 20 mA</td> </tr> <tr> <td>< 240 mV rms</td> <td>200 mA</td> </tr> <tr> <td>< 600 mV rms</td> <td>2000 mA</td> </tr> </table>		< 220 mV rms	200 µA thru 20 mA	< 240 mV rms	200 mA	< 600 mV rms	2000 mA	<p>Max. Burden at Full Scale</p> <table border="1"> <tr> <td>< 220 mV rms</td> <td>200 µA thru 20 mA</td> </tr> <tr> <td>< 240 mV rms</td> <td>200 mA</td> </tr> <tr> <td>< 600 mV rms</td> <td>2000 mA</td> </tr> </table>		< 220 mV rms	200 µA thru 20 mA	< 240 mV rms	200 mA	< 600 mV rms	2000 mA														
< 220 mV rms	200 µA thru 20 mA																												
< 240 mV rms	200 mA																												
< 600 mV rms	2000 mA																												
< 220 mV rms	200 µA thru 20 mA																												
< 240 mV rms	200 mA																												
< 600 mV rms	2000 mA																												
<p>Accuracy</p> <table border="1"> <tr> <td>± (1.5% of reading + 80 digits)</td> <td>20 Hz to 10 kHz</td> </tr> <tr> <td>± (1.5% of reading + 80 digits)</td> <td>2000 mA</td> </tr> </table>		± (1.5% of reading + 80 digits)	20 Hz to 10 kHz	± (1.5% of reading + 80 digits)	2000 mA	<p>Accuracy</p> <table border="1"> <tr> <td>± (1.2% of reading + 20 digits)</td> <td>20 Hz to 30 Hz</td> </tr> <tr> <td>± (2% of reading + 50 digits)</td> <td>30 Hz to 10 kHz</td> </tr> </table>		± (1.2% of reading + 20 digits)	20 Hz to 30 Hz	± (2% of reading + 50 digits)	30 Hz to 10 kHz																		
± (1.5% of reading + 80 digits)	20 Hz to 10 kHz																												
± (1.5% of reading + 80 digits)	2000 mA																												
± (1.2% of reading + 20 digits)	20 Hz to 30 Hz																												
± (2% of reading + 50 digits)	30 Hz to 10 kHz																												
<p>Max. Display</p> <table border="1"> <tr> <td>199.99 µA</td> <td>200 µA</td> </tr> <tr> <td>1.9999 mA</td> <td>2 mA</td> </tr> <tr> <td>19.999 mA</td> <td>20 mA</td> </tr> <tr> <td>199.99 mA</td> <td>200 mA</td> </tr> <tr> <td>1999.9 mA</td> <td>2000 mA</td> </tr> </table>		199.99 µA	200 µA	1.9999 mA	2 mA	19.999 mA	20 mA	199.99 mA	200 mA	1999.9 mA	2000 mA	<p>Max. Display</p> <table border="1"> <tr> <td>199.99 µA</td> <td>200 µA</td> </tr> <tr> <td>1.9999 mA</td> <td>2 mA</td> </tr> <tr> <td>19.999 mA</td> <td>20 mA</td> </tr> <tr> <td>199.99 mA</td> <td>200 mA</td> </tr> <tr> <td>1999.9 mA</td> <td>2000 mA</td> </tr> </table>		199.99 µA	200 µA	1.9999 mA	2 mA	19.999 mA	20 mA	199.99 mA	200 mA	1999.9 mA	2000 mA						
199.99 µA	200 µA																												
1.9999 mA	2 mA																												
19.999 mA	20 mA																												
199.99 mA	200 mA																												
1999.9 mA	2000 mA																												
199.99 µA	200 µA																												
1.9999 mA	2 mA																												
19.999 mA	20 mA																												
199.99 mA	200 mA																												
1999.9 mA	2000 mA																												
<p>Accuracy: (for 1 year at 23°C ± 5°C)</p>		<p>Accuracy: (for 1 year at 23°C ± 5°C)</p>																											

Table 1-1. Specifications (Cont'd).

16 March 1978

Supplement A for 03466-90001

Page 6-8, Table 6-3. Add A4C908, 0180-0197, 2.2 μ F and A4R970, 0757-0446, 15 K 1% to the parts list.

CHANGE NO. 1 applies to serial numbers 1716A01186 and greater.

near U300.

Page 8-21, Figure 8-19. Change the value of R301 and 302 to 124 K and 500 K respectively. These components are located in two places on the schematic - near the A5 PC board assembly, and in the middle of Schematic No. 3

Page 6-11, Figure 6-1. Add (2) to the exploded view near (11).

Page 6-11, Figure 6-1. Add (2) to the exploded view near (11).

Page 6-10, Table 6-4. Change the part number of index from 2190-0016 to 2190-3666. Change the order of the part number and description for index (2) and (3). The correct order should be, "1400-0053, cable clamp," index "1420-0233, 6 V battery pack," Add index " (2) , 7120-6188, -hp- logo,"

Page 6-10, Table 6-4. Change the part number of index from 2190-0016 to 2190-3666. Change the order of the part number and description for index (2) and (3).

Page 6-8, Table 6-3. Change the part number and description of A4R910 through R924 from "0683-1029, resistor 1 K" to "0683-8215, resistor 820 ohms."

Page 6-5, Table 6-3. Change the description of A1R616 from 4.25 K to 42.5 K.

Page 6-4, Table 6-3. The description for A1R408 is resistor 49.2 K ohms .1%.

Page 6-3, Table 6-3. Make the following corrections to the Replaceable Parts Lists. Change the description of A1C100 from 200 pF to .1 μ F. Add 6.95 V to the description of A1CF500.

Page 5-7/5-8, Figure 5-2. Change (9) from 1.9 VAC to 19 VAC.

Page 4-8, Figure 4-11. Change the ground symbol at the output cable 11055B from  to .

Page 4-6, Figure 4-7. Delete the ground symbol located near the 740B output cable.

Page 4-6, Table 4-8. Under AC Calibrator Frequency, change the 2 mA range from 100 Hz to 30 Hz.

Page 4-5, Table 4-6. Under Current Level of the 2 milli-amp range, change 2 mA to .2 mA.

reading + 20 digits)/ $^{\circ}$ C.

ERRATA

► New or Revised Item

Page 1-2, Table 1-1. Under DC Voltmeter accuracy specifications, change the 200 mV range from \pm (.04% of reading + 1 digit) to \pm (.04% of reading + 2 digits). Under AC VOLTMETER (TRUE RMS), change Sinewave Accuracy to the following:

Frequency	Accuracy (all ranges)
20 Hz - 30 Hz	\pm (2% of reading + 50 digits)
30 Hz - 50 Hz	\pm (1% of reading + 30 digits)
50 Hz - 10 KHz	\pm (0.3% of reading + 20 digits)
10 KHz - 20 KHz	\pm (1% of reading + 40 digits)
20 KHz - 100 KHz	\pm (2% of reading + 150 digits)

Frequency	Temperature Coefficient (all ranges)
20 Hz to 30 Hz and 20 KHz to 100 KHz	\pm (.05% of reading + 15 digits)/ $^{\circ}$ C
30 Hz to 50 Hz and 10 KHz to 20 KHz	\pm (.05% of reading + 2 digits)/ $^{\circ}$ C
50 Hz to 10 KHz	\pm (.03% of reading + 5 digits)/ $^{\circ}$ C

Under DC + AC VOLTMETER (TRUE RMS) change the Maximum Input to, "1200 Vdc or 1700 V (dc + peak ac), 10⁷ V Hz.

Range & Temperature	Accuracy	Temperature Coefficient
2 V - 1200 V	\pm (.03% + 6 digits)/ $^{\circ}$ C	\pm (.05% + 10 digits)/ $^{\circ}$ C
200 mV	\pm (.03% + 20 digits)/ $^{\circ}$ C	\pm (.05% + 30 digits)/ $^{\circ}$ C
0 $^{\circ}$ - 55 $^{\circ}$ C		
0 $^{\circ}$ - 40 $^{\circ}$ C		
20 mV		
-40 $^{\circ}$ C - 55 $^{\circ}$ C		

Page 1-3, Table 1-1. Under DC AMMETER, change the first line of the Voltage Burden specification to read, "200 μ A through 20 mA < 220 mV.

Under DC + AC AMMETER (TRUE RMS), change the Accuracy specification under Frequency to read DC + 20 Hz to 10 KHz.

Change Temperature Coefficient to read, " \pm (.03% of



MANUAL CHANGES

-hp- MODEL 3466A

DIGITAL MULTIMETER

Manual Part Number 03466-90001

Page 8-23, Figure 8-20. Change the A4 component location as shown in Figure CS-1.
 Page 8-25/8-26, Figure 8-21. On the A1 schematic drawing for the power supply, change the destination of the Vsub (-2/6) power supply from 1, 2 to 3. Change the destination of the Vdisp power supply to 3, 4.

Change the A4 schematic drawing as shown in Figure CS2.

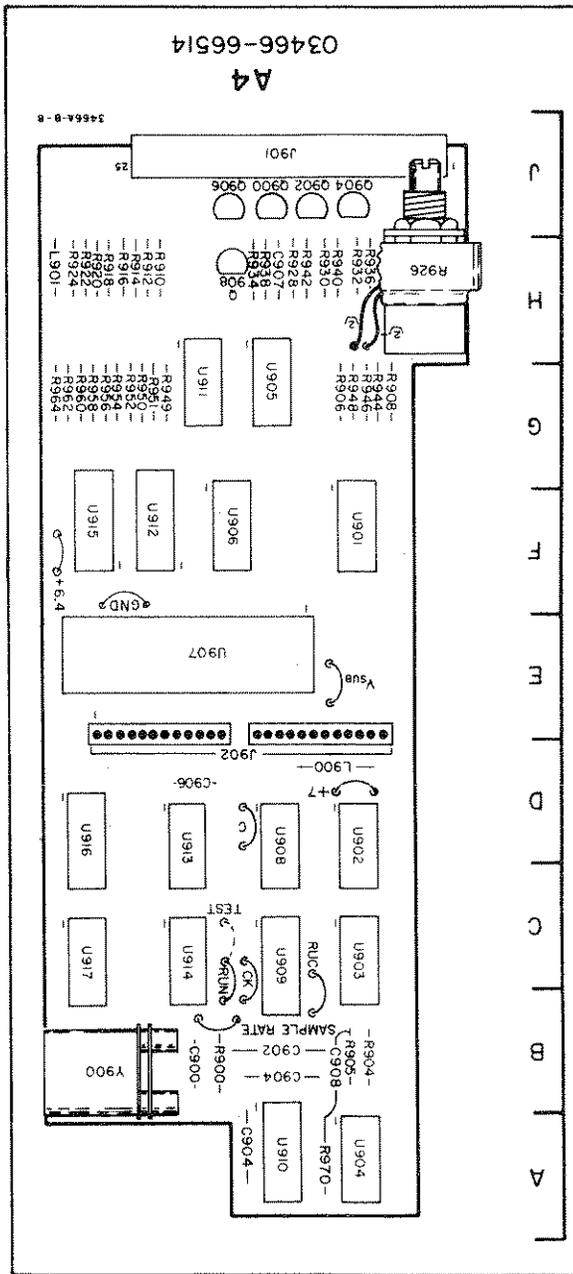


Figure CS-1.

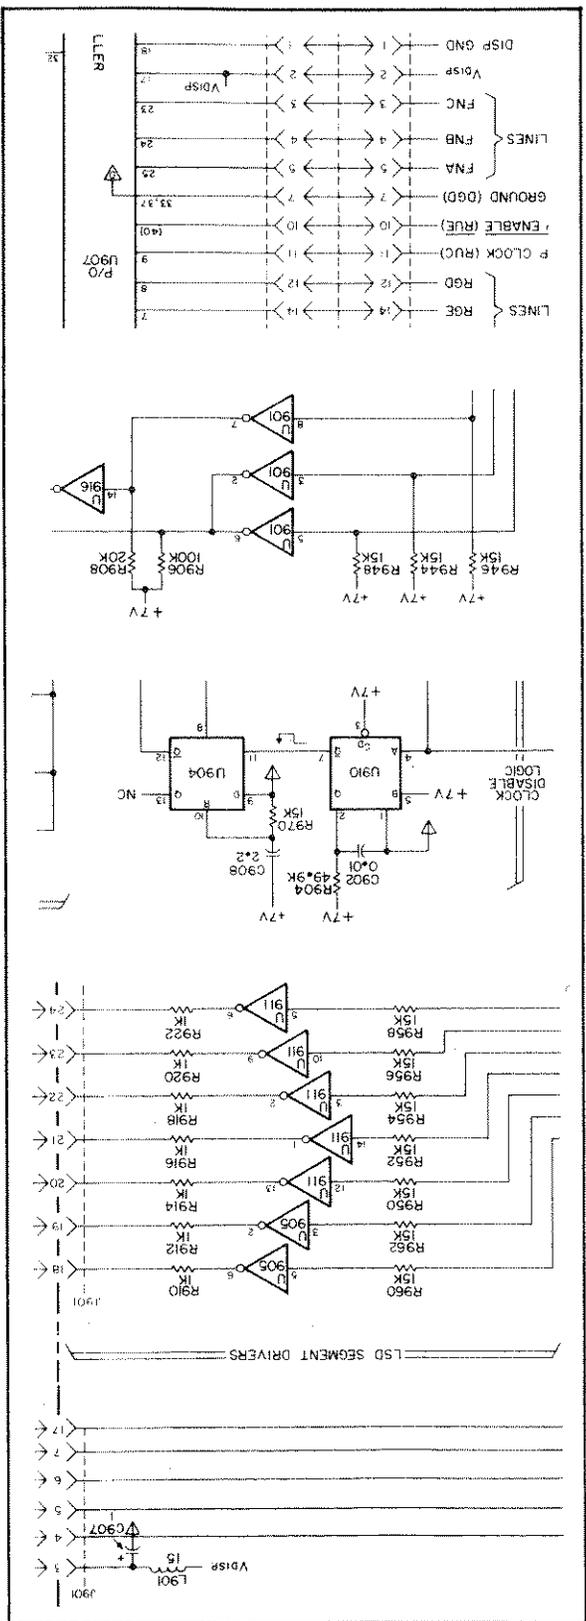


Figure CS-2.

SECTION I GENERAL INFORMATION

Model 3466A

Section I

1-1. INTRODUCTION.

1-2. This section contains general information concerning the -hp- Model 3466A Multimeter. Included is an instrument description, specifications, information about instrument and manual identification, option and accessory information, and safety considerations.

1-3. DESCRIPTION.

1-4. The -hp- Model 3466A is a 4½ digit, seven function, autorangeing multimeter. The functions are AC or DC Voltage, AC or DC Current, AC + DC Voltage, AC + DC Current and Ohms. All seven functions have manually selectable ranges. AC Voltage, DC Voltage, AC + DC Voltage and Ohms functions may also be automatically ranged by pressing the AUTO pushbutton. Throughout the remainder of this manual, the -hp- Model 3466A Multimeter will be referred to as Multimeter.

1-5. SPECIFICATIONS.

1-6. Specifications for the Multimeter are listed in Table 1-1. These specifications are the performance standards or limits to which the Multimeter can be tested. Any changes in these specifications due to manufacturing changes, design or traceability to the National Bureau of Standards will be covered by an errata or change sheet. These specifications supersede any prior published specifications. Supplemental information in Table 1-2 is provided to describe general operating characteristics.

1-7. INSTRUMENT AND MANUAL IDENTIFICATION.

1-8. Hewlett-Packard uses a two-section serial number. The first section (prefix) identifies a series of instruments. The last section (suffix) identifies a particular instrument within the series. A letter between the prefix and the suffix identifies the country in which the instrument was manufactured. The manual is kept up-to-date at all times by means of a change sheet which is supplied with the manual. If the serial number of your instrument differs from the one on the title

1-14. SAFETY CONSIDERATIONS.

1-15. This Operating and Service Manual contains cautions and warnings alerting the user to hazardous operating and maintenance conditions. This information is flagged by a ∇ symbol appears on the front panel and is an international symbol meaning "refer to the Operating and Service Manual". This symbol flags important operating instructions located in Section III. To ensure the safety of the operating and maintenance personnel and retain the operating condition of the instrument, these instructions must be followed.

1-12. ACCESSORIES.

1-13. The accessories available for use with the Multimeter are listed in Table 1-4.

Number 03435-80001.

Option 001 Multimeters can be converted to standards by adding the battery and charger circuits. The Battery/Charger kit is -hp- Part

NOTE

1-11. The option label affixed to the rear of the Multimeter identifies the line voltage for which the instrument is wired. This operating voltage can be changed by following the procedure outlined in Section V (Power Requirement Modification Instructions). If the line voltage option is changed, the option label should also be corrected to reflect the new configuration.

1-10. Table 1-3 lists the option available for the Multimeter.

1-9. OPTIONS.

page of this manual, refer to the change sheet supplied with the manual. All correspondence with Hewlett-Packard should include the complete serial number.

DC AMMETER		AC AMMETER (TRUE RMS)																																	
<p>Accuracy: (for 1 year at 23°C ± 5°C):</p> <table border="1"> <tr> <td>200 μA</td> <td>± (0.7% of reading + 2 digits)</td> </tr> <tr> <td>199.99 μA</td> <td>± (0.7% of reading + 2 digits)</td> </tr> <tr> <td>100 Ω</td> <td>± (0.7% of reading + 2 digits)</td> </tr> <tr> <td>10 Ω</td> <td>± (0.7% of reading + 2 digits)</td> </tr> <tr> <td>1 Ω</td> <td>± (1.5% of reading + 2 digits)</td> </tr> <tr> <td>0.1 Ω</td> <td>± (5% of reading + 2 digits)</td> </tr> </table>		200 μA	± (0.7% of reading + 2 digits)	199.99 μA	± (0.7% of reading + 2 digits)	100 Ω	± (0.7% of reading + 2 digits)	10 Ω	± (0.7% of reading + 2 digits)	1 Ω	± (1.5% of reading + 2 digits)	0.1 Ω	± (5% of reading + 2 digits)	<p>Accuracy: (for 1 year at 23°C ± 5°C):</p> <table border="1"> <tr> <td>200 μA</td> <td>± (2% of reading + 50 digits)</td> </tr> <tr> <td>20 Hz to 30 Hz</td> <td>± (2% of reading + 50 digits)</td> </tr> <tr> <td>30 Hz to 10 kHz</td> <td>± (1.2% of reading + 20 digits)</td> </tr> </table>		200 μA	± (2% of reading + 50 digits)	20 Hz to 30 Hz	± (2% of reading + 50 digits)	30 Hz to 10 kHz	± (1.2% of reading + 20 digits)														
200 μA	± (0.7% of reading + 2 digits)																																		
199.99 μA	± (0.7% of reading + 2 digits)																																		
100 Ω	± (0.7% of reading + 2 digits)																																		
10 Ω	± (0.7% of reading + 2 digits)																																		
1 Ω	± (1.5% of reading + 2 digits)																																		
0.1 Ω	± (5% of reading + 2 digits)																																		
200 μA	± (2% of reading + 50 digits)																																		
20 Hz to 30 Hz	± (2% of reading + 50 digits)																																		
30 Hz to 10 kHz	± (1.2% of reading + 20 digits)																																		
<p>Response Time: < 4.5 seconds to within 4 digits of final value.</p> <p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 μA thru 200 mA</td> <td>± (0.3% of reading + 5 digits)/°C</td> </tr> <tr> <td>2000 mA</td> <td>± (0.4% of reading + 5 digits)/°C</td> </tr> </table>		200 μA thru 200 mA	± (0.3% of reading + 5 digits)/°C	2000 mA	± (0.4% of reading + 5 digits)/°C	<p>Response Time: < 0.7 seconds to within 1 digit of final value.</p> <p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 μA thru 20 mA</td> <td>± (0.04% of reading + 15 digits)/°C</td> </tr> <tr> <td>200 mA thru 2000 mA</td> <td>± (0.1% of reading + 15 digits)/°C</td> </tr> </table>		200 μA thru 20 mA	± (0.04% of reading + 15 digits)/°C	200 mA thru 2000 mA	± (0.1% of reading + 15 digits)/°C																								
200 μA thru 200 mA	± (0.3% of reading + 5 digits)/°C																																		
2000 mA	± (0.4% of reading + 5 digits)/°C																																		
200 μA thru 20 mA	± (0.04% of reading + 15 digits)/°C																																		
200 mA thru 2000 mA	± (0.1% of reading + 15 digits)/°C																																		
<p>Sensitivity: 10 nA on the 200 μA range.</p> <p>Input Type: Floating (500 V max. from COM to earth ground).</p> <p>Ranging: Manual only.</p> <p>Maximum Input: ± 2 Amps from ≤ 250 V Source.</p>		<p>Sensitivity: 10 nA on the 200 μA range.</p> <p>Input Type: Floating (500 V max. from COM to earth ground).</p> <p>Ranging: Manual only.</p> <p>Maximum Input: 2 Amps rms from ≤ 250 V rms source.</p>																																	
<p>DC + AC AMMETER (TRUE RMS).</p> <table border="1"> <tr> <td>200 μA thru 20 mA</td> <td>200 μA thru 20 mA</td> </tr> <tr> <td>200 mA</td> <td>200 mA</td> </tr> <tr> <td>2 mA</td> <td>2 mA</td> </tr> <tr> <td>199.99 μA</td> <td>199.99 μA</td> </tr> <tr> <td>19.999 mA</td> <td>19.999 mA</td> </tr> <tr> <td>200 mA</td> <td>200 mA</td> </tr> <tr> <td>199.99 mA</td> <td>199.99 mA</td> </tr> <tr> <td>2000 mA</td> <td>2000 mA</td> </tr> </table>		200 μA thru 20 mA	200 μA thru 20 mA	200 mA	200 mA	2 mA	2 mA	199.99 μA	199.99 μA	19.999 mA	19.999 mA	200 mA	200 mA	199.99 mA	199.99 mA	2000 mA	2000 mA	<p>DC + AC AMMETER (TRUE RMS).</p> <table border="1"> <tr> <td>200 μA thru 20 mA</td> <td>200 μA thru 20 mA</td> </tr> <tr> <td>200 mA</td> <td>200 mA</td> </tr> <tr> <td>2 mA</td> <td>2 mA</td> </tr> <tr> <td>199.99 μA</td> <td>199.99 μA</td> </tr> <tr> <td>19.999 mA</td> <td>19.999 mA</td> </tr> <tr> <td>200 mA</td> <td>200 mA</td> </tr> <tr> <td>199.99 mA</td> <td>199.99 mA</td> </tr> <tr> <td>2000 mA</td> <td>2000 mA</td> </tr> </table>		200 μA thru 20 mA	200 μA thru 20 mA	200 mA	200 mA	2 mA	2 mA	199.99 μA	199.99 μA	19.999 mA	19.999 mA	200 mA	200 mA	199.99 mA	199.99 mA	2000 mA	2000 mA
200 μA thru 20 mA	200 μA thru 20 mA																																		
200 mA	200 mA																																		
2 mA	2 mA																																		
199.99 μA	199.99 μA																																		
19.999 mA	19.999 mA																																		
200 mA	200 mA																																		
199.99 mA	199.99 mA																																		
2000 mA	2000 mA																																		
200 μA thru 20 mA	200 μA thru 20 mA																																		
200 mA	200 mA																																		
2 mA	2 mA																																		
199.99 μA	199.99 μA																																		
19.999 mA	19.999 mA																																		
200 mA	200 mA																																		
199.99 mA	199.99 mA																																		
2000 mA	2000 mA																																		
<p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 μA thru 200 mA</td> <td>± (0.3% of reading + 5 digits)/°C</td> </tr> <tr> <td>2000 mA</td> <td>± (0.4% of reading + 5 digits)/°C</td> </tr> </table>		200 μA thru 200 mA	± (0.3% of reading + 5 digits)/°C	2000 mA	± (0.4% of reading + 5 digits)/°C	<p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 μA thru 20 mA</td> <td>± (2% of reading + 50 digits)</td> </tr> <tr> <td>20 Hz to 30 Hz</td> <td>± (2% of reading + 50 digits)</td> </tr> <tr> <td>30 Hz to 10 kHz</td> <td>± (1.2% of reading + 35 digits)</td> </tr> </table>		200 μA thru 20 mA	± (2% of reading + 50 digits)	20 Hz to 30 Hz	± (2% of reading + 50 digits)	30 Hz to 10 kHz	± (1.2% of reading + 35 digits)																						
200 μA thru 200 mA	± (0.3% of reading + 5 digits)/°C																																		
2000 mA	± (0.4% of reading + 5 digits)/°C																																		
200 μA thru 20 mA	± (2% of reading + 50 digits)																																		
20 Hz to 30 Hz	± (2% of reading + 50 digits)																																		
30 Hz to 10 kHz	± (1.2% of reading + 35 digits)																																		
<p>Response Time: < 4.5 seconds to within 4 digits of final value.</p> <p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 μA thru 200 mA</td> <td>± (0.3% of reading + 10 digits)/°C</td> </tr> <tr> <td>2000 mA</td> <td>± (0.4% of reading + 10 digits)/°C</td> </tr> </table>		200 μA thru 200 mA	± (0.3% of reading + 10 digits)/°C	2000 mA	± (0.4% of reading + 10 digits)/°C	<p>Response Time: < 4.5 seconds to within 4 digits of final value.</p> <p>Temperature Coefficient: (0°C to 18°C and 28°C to 55°C):</p> <table border="1"> <tr> <td>200 μA thru 200 mA</td> <td>± (0.3% of reading + 10 digits)/°C</td> </tr> <tr> <td>2000 mA</td> <td>± (0.4% of reading + 10 digits)/°C</td> </tr> </table>		200 μA thru 200 mA	± (0.3% of reading + 10 digits)/°C	2000 mA	± (0.4% of reading + 10 digits)/°C																								
200 μA thru 200 mA	± (0.3% of reading + 10 digits)/°C																																		
2000 mA	± (0.4% of reading + 10 digits)/°C																																		
200 μA thru 200 mA	± (0.3% of reading + 10 digits)/°C																																		
2000 mA	± (0.4% of reading + 10 digits)/°C																																		
<p>Maximum Crest Factor: 4 to 1 at full scale.</p> <p>Error at Max. Crest Factor: 4.5%, subject to 10 KHz bandwidth limitation.</p> <p>Voltage Burden:</p> <table border="1"> <tr> <td>200 μA thru 20 mA</td> <td>< 220 mV rms</td> </tr> <tr> <td>200 mA</td> <td>< 240 mV rms</td> </tr> <tr> <td>2000 mA</td> <td>< 400 mV rms</td> </tr> </table>		200 μA thru 20 mA	< 220 mV rms	200 mA	< 240 mV rms	2000 mA	< 400 mV rms	<p>Maximum Crest Factor: 4 to 1 at full scale.</p> <p>Error at Max. Crest Factor: 4.5% subject to 10 KHz bandwidth limitation.</p> <p>Voltage Burden:</p> <table border="1"> <tr> <td>200 μA thru 20 mA</td> <td>< 220 mV rms</td> </tr> <tr> <td>200 mA</td> <td>< 240 mV rms</td> </tr> <tr> <td>2000 mA</td> <td>< 400 mV rms</td> </tr> </table>		200 μA thru 20 mA	< 220 mV rms	200 mA	< 240 mV rms	2000 mA	< 400 mV rms																				
200 μA thru 20 mA	< 220 mV rms																																		
200 mA	< 240 mV rms																																		
2000 mA	< 400 mV rms																																		
200 μA thru 20 mA	< 220 mV rms																																		
200 mA	< 240 mV rms																																		
2000 mA	< 400 mV rms																																		
<p>Input Protection: 2A, 250 V Fuse.</p>		<p>Input Protection: 2A, 250 V Fuse.</p>																																	

Table 1-1. Specifications (Cont'd).

Standard	Streamlined portable case with handle. AC line or re-chargeable battery operation with battery charger included.
Option 001	Streamlined portable case with handle. AC line operation only.
Option 100	86 - 106 Vac 48 - 440 Hz 9 Watts (Standard)
Option 115	104 - 127 Vac 48 - 440 Hz 9 Watts (Standard)
Option 210	190 - 233 Vac 48 - 440 Hz 9 Watts (Standard)
Option 230	208 - 250 Vac 48 - 440 Hz 9 Watts (Standard)
Option 910	An additional Operating and Service Manual.

Table 1-3. Options.

11002A	Test leads (dual banana to dual alligator).
11003A	Test leads dual banana to probe and alligator.
11096B	RF Probe 10 kHz to 700 MHz, use only 10 V and 100 V dc ranges.
34110A	Soft vinyl carrying/operating case.
34111A	High voltage probe, 40 kV dc.
34112A	Touch - Hold, input probe.
11067A	Test lead kit.

Table 1-4. Accessories.

GENERAL:	
Display: 7 segment RED 0.3 inch high LEDs. Function and range annunciation.	Reading Rate: 2.4 - 4.7/sec. depending on input level.
A-D Conversion: Dual slope.	Integration Time: 100 msec.
Ranging: Automatic or manual in acV, dcV, acV + dcV and Ohms. Manual only in acI, dcI and acI + dcI.	Storage Temperature: (-55 to +75)°C; (-55 to +65)°C with batteries.
Operating Temperature: (0 to 55)°C.	Humidity: 0 - 95% RH at 40°C.
Power: AC line; 48 - 440 Hz	86-106 V Opt. 100 104-127 V Opt. 115 190-233 V Opt. 210 208-250 V Opt. 230
Weight: 3466A: 2.77 kg (6 lbs 2 oz.) 3466A Option 001: 1.98 kg (4 lbs 6 oz.)	

Table 1-2. General Information.

OHMMETER.	
Accuracy: (for 1 year at 23°C ± 5°C):	
Range	Max. Display
20 Ω	19,999 Ω
200 Ω	199,99 Ω
2 kΩ	1,999 Ω
20 kΩ	19,999 kΩ
200 kΩ	199,99 kΩ
2 MΩ	1,999 MΩ
20 MΩ	19,999 MΩ
Accuracy	Output at
± (.08% of reading + 2 digits)	50 mV
± (.08% of reading + 2 digits)	5 mA
± (.03% of reading + 1 digit)	1 mA
± (.03% of reading + 1 digit)	100 μA
± (.03% of reading + 1 digit)	10 μA
± (.04% of reading + 1 digit)	1 μA
± (.15% of reading + 1 digit)	100 nA
Ranging: Automatic or Manual.	
Input Configuration: 2 wire with lead zero (700 mΩ adjust-ment range on the 20 Ω and 200 ranges only).	
Sensitivity: 1 mΩ on the 20 Ω range.	
Output Voltage: < 5 volts dc.	
Overload Protection: 350 V (dc + peak ac).	
DIODE TEST.	
Function: → (kΩ).	
Range: → (2 kΩ).	
Test Current: 1 mA ± 1.5%.	
Maximum Measurable Voltage Drop: 1,9999 volts.	
Overload Protection: 350 V (dc + peak ac).	
TEMPERATURE COEFFICIENT: (0°C to 18°C and 28°C to 55°C):	
Temperature Coefficient	Range
± (.002% of reading + .05 digits)/°C	20 Ω thru 2 MΩ
± (.01% of reading + .1 digits)/°C	20 MΩ
Response Time: < 1.1 seconds to within 1 digit of final value on one range. Add 0.8 seconds for each of range change.	

Table 1-1. Specifications (Cont'd).

SECTION II INSTALLATION

NOTE

If the instrument is to be shipped to Hewlett-Packard for service or repair, attach a tag to the instrument identifying the owner and indicating the service or repair to be accomplished. Include the model number and full serial number of the instrument. In any correspondence, identify the instrument by model number and full serial number.

2-11. Place instrument in original container with appropriate packing material and seal with strong tape or metal bands. If original container is not available, one can be purchased from your nearest -hp- Sales and Service Office.

2-12. If original container is not to be used, proceed as follows:

a. Wrap instrument in heavy paper or plastic before placing in an inner container.

b. Place packing material around all sides of instrument and protect front panel with cardboard strips.

c. Place instrument and inner container in a heavy carton or wooden box and seal with strong tape or metal bands.

2-13. POWER CORDS AND RECEPTACLES.

2-14. Figure 2-1 illustrates the plug cap configurations that are available to provide ac power to the Multimeter. The -hp- part number shown directly below each plug cap drawing is the part number for the power cord set equipped with the appropriate mating plug for that receptacle. The appropriate power cord should be provided with each instrument. However, if a different power cord set is required, notify the nearest -hp- Sales and Service Office and a replacement cord will be provided. The instrument ac power input receptacle and cord set appliance coupler meet the safety specifications set by the International Commission on Rules for the Approval of Electrical Equipment (CEE 22).

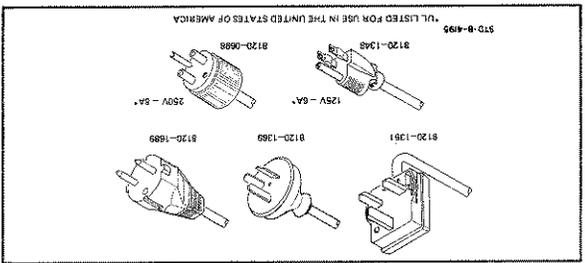


Figure 2-1. Power Receptacles.

2-1. INTRODUCTION.

2-2. This section contains information and instructions for the installation and shipping of the Multimeter. Included are initial inspection procedures, power and grounding requirements, environmental information, and instructions for repackaging the instrument for shipment.

2-3. INITIAL INSPECTION.

2-4. This instrument was carefully inspected both mechanically and electrically before shipment. It should be free of marks or scratches and in perfect electrical order upon receipt. To confirm this, the instrument should be inspected for physical damage in transit. Electrical performance should be tested using the performance test outlined in Section IV. If there is damage or deficiency, see the warranty inside the front of this manual.

2-5. POWER REQUIREMENTS.

2-6. The Multimeter can be operated from any one of the ac power sources listed in Table I-2. Before connecting the instrument to ac power, verify that the ac power source matches the power requirement of the instrument as marked on the option label affixed to the rear of the instrument. If the instrument is incompatible with the available power source, refer to Section V for Power Requirement Modification instructions.

2-7. ENVIRONMENTAL REQUIREMENTS.

2-8. The Multimeter will meet the specifications listed in Table I-1 when the operating temperature is within the range of +18°C to +28°C. The instrument can be operated where the ambient temperature is within the range of 0°C to +55°C.


WARNING

To help minimize the possibility of electrical fire or shock hazards, do not expose this instrument to rain or excess moisture.

2-9. REPACKAGING FOR SHIPMENT.

2-10. The following paragraphs contain a general guide for repackaging the instrument for shipment. Refer to Paragraph 2-11 if the original container is to be used; 2-12 if it is not. If you have any questions, contact your nearest -hp- Sales and Service Office (See Appendix A for office locations).

Figure 3-1. Description of Controls and Connectors.

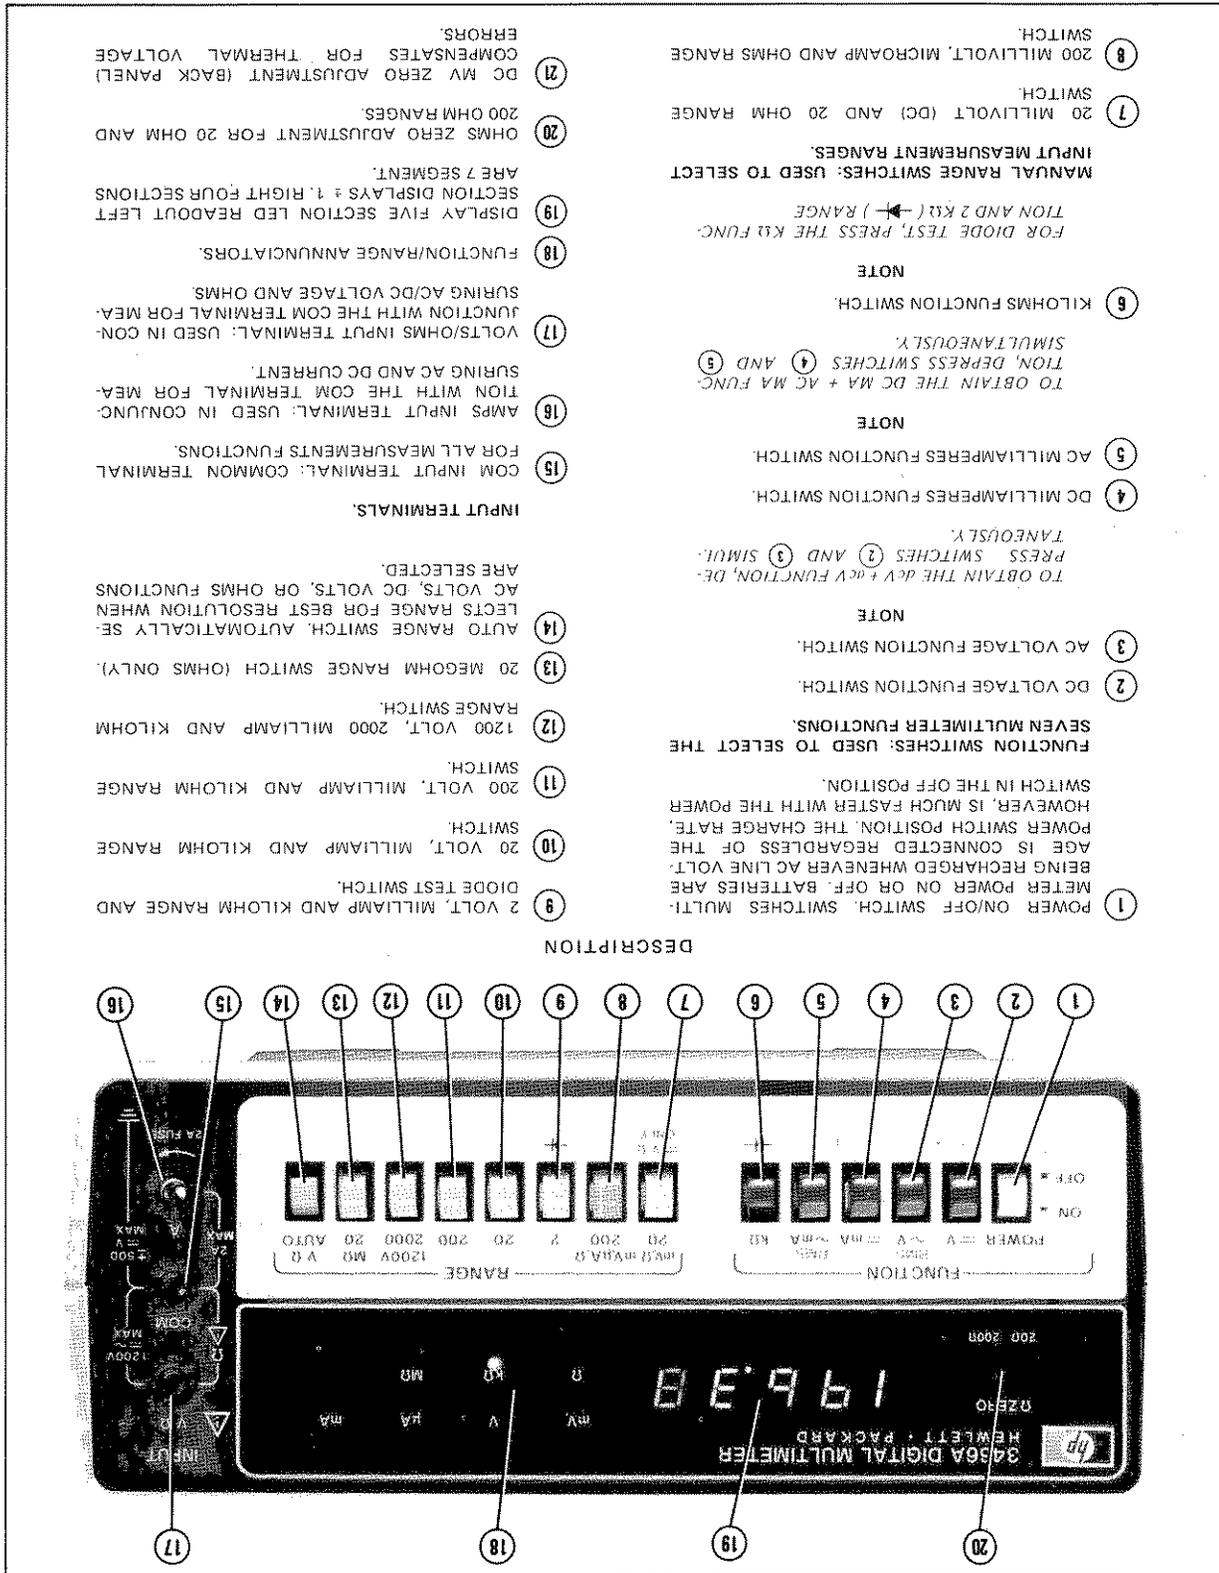

DESCRIPTION

1 POWER ON/OFF SWITCH. SWITCHES MULTI-METER POWER ON OR OFF. BATTERIES ARE BEING RECHARGED WHENEVER AC LINE VOLTAGE IS CONNECTED REGARDLESS OF THE POWER SWITCH POSITION. THE CHARGE RATE, HOWEVER, IS MUCH FASTER WITH THE POWER SWITCH IN THE OFF POSITION.

FUNCTION SWITCHES: USED TO SELECT THE SEVEN MULTIMETER FUNCTIONS.

2 DC VOLTAGE FUNCTION SWITCH.
3 AC VOLTAGE FUNCTION SWITCH.

NOTE
TO OBTAIN THE DC VOLTAGE FUNCTION, DEPRESS SWITCHES 2 AND 3 SIMULTANEOUSLY.

4 DC MILLIAMPERES FUNCTION SWITCH.
5 AC MILLIAMPERES FUNCTION SWITCH.

NOTE
TO OBTAIN THE DC MA + AC MA FUNCTION, DEPRESS SWITCHES 4 AND 5 SIMULTANEOUSLY.

6 KILOHMS FUNCTION SWITCH.

NOTE
FOR DIODE TEST, PRESS THE KILOFUNCTION AND 2 KILOFUNCTION RANGE

MANUAL RANGE SWITCHES: USED TO SELECT INPUT MEASUREMENT RANGES.

7 20 MILLIVOLT (DC) AND 20 OHM RANGE SWITCH.
8 200 MILLIVOLT, MICROAMP AND OHMS RANGE SWITCH.

9 2 VOLT, MILLIAMP AND KILOHM RANGE AND DIODE TEST SWITCH.

10 20 VOLT, MILLIAMP AND KILOHM RANGE SWITCH.

11 200 VOLT, MILLIAMP AND KILOHM RANGE SWITCH.

12 1200 VOLT, 2000 MILLIAMP AND KILOHM RANGE SWITCH.

13 20 MEGOHM RANGE SWITCH (OHMS ONLY).

14 AUTO RANGE SWITCH. AUTOMATICALLY SELECTS RANGE FOR BEST RESOLUTION WHEN AC VOLTS, DC VOLTS, OR OHMS FUNCTIONS ARE SELECTED.

INPUT TERMINALS.

15 COM INPUT TERMINAL: COMMON TERMINAL FOR ALL MEASUREMENTS FUNCTIONS.

16 AMPS INPUT TERMINAL: USED IN CONNECTION WITH THE COM TERMINAL FOR MEASURING AC AND DC CURRENT.

17 VOLTS/OHMS INPUT TERMINAL: USED IN CONNECTION WITH THE COM TERMINAL FOR MEASURING AC/DC VOLTAGE AND OHMS.

18 FUNCTION/RANGE ANNUNCIATORS.

19 DISPLAY FIVE SECTION LED READOUT LEFT SECTION DISPLAYS 1. RIGHT FOUR SECTIONS ARE 7 SEGMENT.

20 OHMS ZERO ADJUSTMENT FOR 20 OHM AND 200 OHM RANGES.

21 DC MV ZERO ADJUSTMENT (BACK PANEL) COMPENSATES FOR THERMAL VOLTAGE ERRORS.

SECTION III OPERATING INSTRUCTIONS

3-1. INTRODUCTION.

3-2. This section contains instructions for operating the Multimeter. Measurements of ac and dc voltage, ac and dc current, and ohms are discussed. A description of the controls and connectors is given in Figure 3-1.



To prevent potential electrical or fire hazard, do not expose the Multimeter or its accessories to rain or moisture.

3-3. AC Operation.

3-4. Before connecting the Multimeter to ac power, verify that the ac power source matches the power requirements of the Multimeter as marked on the option label affixed to the rear of the instrument. If the instrument is incompatible with the available power source, refer to Section V of this manual for power requirement modification instructions. After this verification, connect the proper ac power to the instrument and press the ON button. The instrument is ready for use.

3-5. Battery Operation.

3-6. **Recharging the Battery.** Before operating the Multimeter in the Battery Mode, ensure that the battery is charged. Connect the Multimeter to the proper ac line voltage and allow 12 hours for a full recharge with the POWER switch off (out). This provides a minimum operating time of 8 hours. A 1.5 hour recharge (instrument off) will allow an operating time of 3 hours. Operating the instrument with the proper ac line voltage connected and the POWER switch on, provides a full battery recharge in 16 hours.

NOTE

Repeated partial charge cycles may result in a temporary loss of battery capacity. Normal capacity can be restored by fully charging the battery.

3-7. **Low Battery Voltage.** The Multimeter will operate in Battery Mode when the battery voltage is greater than 5.6 V. This voltage is measured through the access hole on the bottom of the Multimeter. To accomplish this, perform the following procedure:

- a. Disconnect ac line voltage.
- b. Select dcV function and 20 V range.

Function	Range	mV, Ω	M Ω	20	M Ω
==V	M Ω			20	
~V	M Ω			20	
==V + ~V	M Ω			20	
==mA	M Ω			20	Auto
~mA	M Ω			20	Auto
==mA + ~mA	M Ω			20	Auto

Table 3-1. Improper Switch Combinations.

3-12. Table 3-1 lists improper switch combinations.

Figure 3-3. Overload Indication.




3-11. Figure 3-3 shows the display indication during overload, overrange, or an improper switch setting.

3-10. Overload/Overrange/Improper Function Indication.

3-8. If the battery voltage drops below 5.6 volts, the Multimeter will automatically stop operating (blank display) to prevent damage to the battery. If this occurs, recharge the battery.

3-9. If the display has blanked due to low battery voltage, and there is a requirement to make one or two more measurements before recharging the battery, set the POWER switch to OFF for approximately 15 minutes and then make the measurement. This allows the battery to partially rejuvenate.

Figure 3-2. Battery Voltage Access Hole.

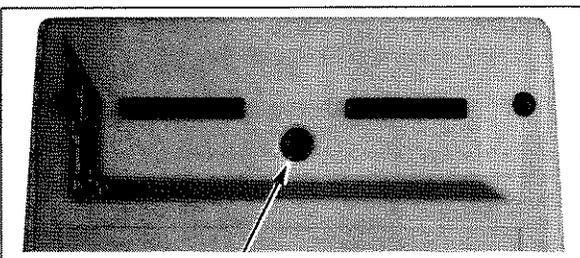


c. Insert the V - Ω test probe into the access hole as shown in Figure 3-2.

3-2

3-19. A (Amps). The A terminal is the high terminal for ac and dc amps measurements. There is a 2 amp input protection fuse in series with this terminal.

 To avoid possible damage to the Multimeter circuitry, the voltage between COM and earth ground must not exceed ± 500 Vdc.




3-18. COM (Common). The COM terminal is used for all five Multimeter functions. It is the negative (-) terminal for ohms measurements and it is the low terminal for ac and dc voltage and current measurements.

3-17. V Ω (Volts/Ohms). The V Ω terminal is the high terminal for ac and dc voltage measurement. For ohms measurements, it is the positive (+) terminal.

3-16. Input Terminals.

3-15. To release the AUTO switch depress one of the MANUAL RANGE switches.


Figure 3-4. Multimeter Autoranging.

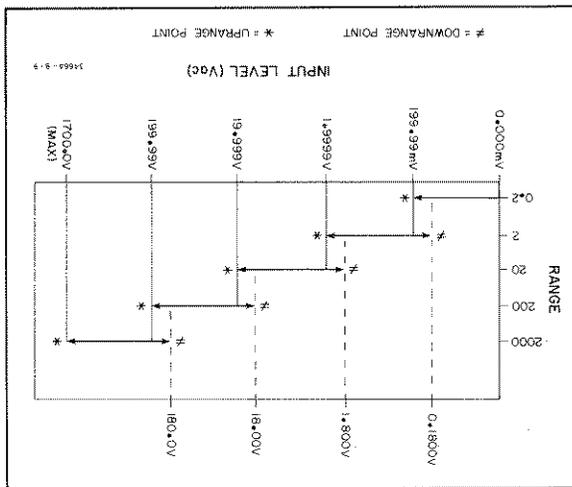

3-14. Depressing the AUTO switch with acV, dcV, acV + dcV or k Ω function selected sets the Multimeter in an automatic ranging mode. In this mode the Multimeter will up-range if the display reading increases above (+) or (-) and down-range if the display decreases below 199999. These numerical autoranging points are irrespective of decimal placement. The difference between the two autoranging points is called autoranging hysteresis. Figure 3-4 shows the autoranging points of ac voltage measurements from 0 to 1700 Vdc. Autoranging in other Multimeter functions is similar.


3-13. Auto.

 To avoid possible damage to the Multimeter circuitry, the ac input voltage must not exceed 600 Vdc or 1700 V (dc + peak ac).



3-22. AC Voltage Measurements.

Figure 3-5. DC Voltage Measurements.

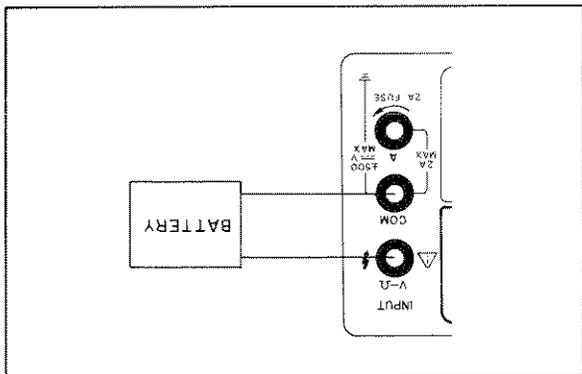


3-21. Procedure:

- a. Depress == V (dc Volts).
- b. Depress proper manual range (200 mV to 1200 V) or depress AUTO for automatic range selection.
- c. Connect test leads from the Multimeter V Ω (high) and COM (low) terminals to the voltage under test as shown in Figure 3-5.

Thermal voltages from test lead connections and measurement circuits are cancelled by setting the Multimeter to the 20 mV range, shorting the test leads together and adjusting the reading to 0.000 mV.


NOTE

 To avoid possible damage to the Multimeter circuitry, the dc input voltage must not exceed 1200 V (dc + peak ac).



3-20. DC Voltage Measurements.

 The current function is protected by a fuse of 250 A rating. To avoid damage to the Multimeter, current sources having open circuit voltages greater than 250 V (dc + peak ac) must not be connected to the A (amps) input terminal.




The current function is protected by a fuse of 250 V rating. To avoid damage to the Multi-meter, current sources having open circuit volt-

CAUTION


3-28. AC Current Measurements.

Figure 3-8. DC Current Measurements.

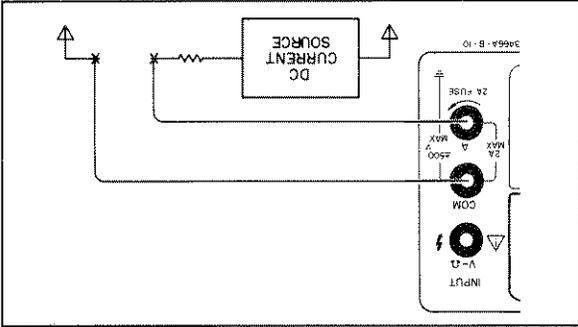

c. Connect test leads from the Multimeter A and COM terminals in series with the current under test as shown in Figure 3-8.

Figure 3-7. True RMS (dc + ac) Voltage Measurements.

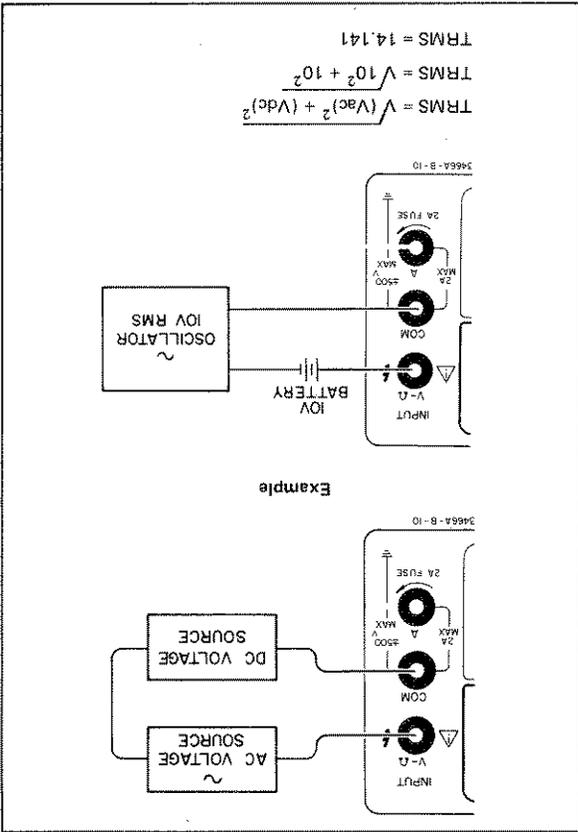

- a. Depress --- mA (dc milliamperes).
- b. Depress proper manual range (200 μA to 2000 mA).

3-27. Procedure:

The current function is protected by a fuse of 250 V rating. To avoid damage to the Multi-meter, current sources having open circuit volt-ages greater than 250 V (dc + peak ac) must not be connected to the A (amps) input terminal.

CAUTION

3-26. DC Current Measurement

- a. Depress --- V and $\sim\text{V}$ simultaneously.
- b. Depress the proper manual range (200 mV to 1200 V) or auto for automatic range selection.
- c. Connect test leads from the multimeter V Ω (high) and COM (low) terminal to the Voltage under test as shown in Figure 3-7.


3-25. Procedure.

To avoid possible damage to the multimeter circuitry, the input voltage must not exceed 1200 Vdc or 1700 V (dc + peak ac).

CAUTION

3-24. True RMS (dc + ac) Voltage Measurements.


Figure 3-6. AC Voltage Measurement.

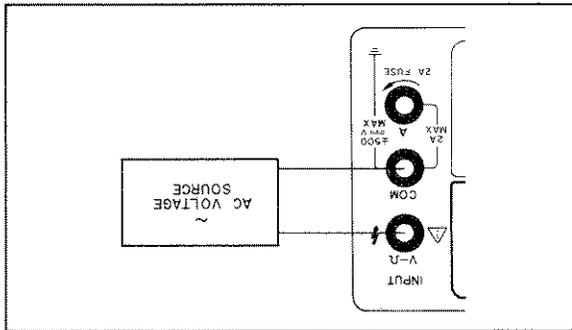

- a. Depress $\sim\text{V}$ (ac volts).
- b. Depress proper manual range (200 mV to 1200 V) or depress AUTO for automatic range selection.
- c. Connect test leads from the Multimeter V Ω (high) and COM (low) terminals to the voltage under test as shown in Figure 3-6.

3-23. Procedure:

Figure 3-10. True RMS Current Measurement.

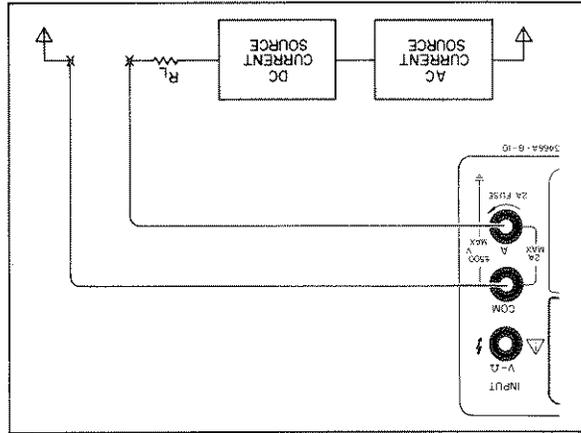

3-32. Resistance Measurements.

- Depress the \rightarrow (k Ω) function.
- Depress \rightarrow (2 k Ω) range.
- Connect test leads across the diode or transistor as shown in Figure 3-12.

NOTE

By selecting the k Ω function and the 2 k Ω range, a 1 mA current source is provided. The display is read directly in volts even though the k Ω annunciator will be lit. The V Ω terminal is the positive (+) lead.

- Depress proper manual range (200 mA to 2000 mA).
- Connect test leads from the Multimeter A and COM terminals in series with the current under test as shown in Figure 3-10.

3-31. Procedure:

Figure 3-9. AC Current Measurement.

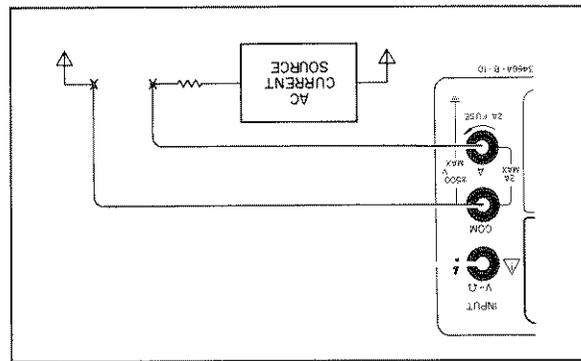


Figure 3-11. Resistance Measurement.

- Depress k Ω (kilohms).
- Depress proper manual range (20 Ω to 20 M Ω).
- Connect test leads from the Multimeter V Ω (+) and COM (-) terminals to the resistance under test as shown in Figure 3-11.

NOTE

Ohms zero is disabled in the 2K thru 20M ranges.

3-34. Procedure:

- Short the test leads together.
- Depress the 20 Ω range.
- Adjust the Ω zero potentiometer for a display reading of 0.000.

3-29. Procedure:

- Depress \sim mA (ac milliamperes).
- Depress proper manual range (200 μ A to 2000 mA).
- Connect test leads from the Multimeter A and COM terminals in series with the current under test as shown in Figure 3-9.

ages greater than 250 V (dc + peak ac) must not be connected to the A (amps) input terminal.

